



# SERVICE BULLETIN



SERVICE DEPARTMENT... CHRYSLER-PLYMOUTH DIVISION  
CHRYSLER MOTORS CORPORATION

TECHNICAL INFORMATION ON  IMPERIAL  CHRYSLER  PLYMOUTH  VALIANT

A new improved Clutch Release Bearing and Sleeve Assembly Part No. 2405077 superseding Part No. 2072852 was incorporated in production on 1963 model Plymouth and Valiant cars built after January 1, 1963.

The new bearing and sleeve incorporate improvements which give better sealing and longer life especially in taxi and police type service.

The new bearing can be used in all applications for which Part No. 2072852 was specified.

Part No. 2405077 listed in this bulletin is stock class code 'P'.

POLICY: INFORMATION ONLY.

J. W. FARLEY  
Manager - Service  
CHRYSLER-PLYMOUTH DIVISION

February 20, 1963

No. 63-65

## CLUTCH

NEW CLUTCH  
RELEASE  
BEARING  
AND  
SLEEVE  
ASSEMBLY

1963  
PLYMOUTH  
AND  
VALIANT  
MODELS  
EQUIPPED  
WITH  
MANUAL  
TRANSMISSION

P-748-C

Service Mgr.	
Shop Foreman	
Technicians	
Parts Mgr.	
Partsmen	



# SERVICE BULLETIN



SERVICE DEPARTMENT... CHRYSLER-PLYMOUTH DIVISION  
CHRYSLER MOTORS CORPORATION


TECHNICAL INFORMATION ON  IMPERIAL  CHRYSLER  PLYMOUTH  VALIANT

October 23, 1963

No. 63-112

If you encounter a groaning noise while depressing the clutch pedal on a 1963 Plymouth or Valiant car equipped with a manual transmission, it may be caused by interference at the corners of the clutch release fork pivot. The corners have been relieved on all 1964 models.

The same correction can be accomplished on 1963 models, by modifying the "L" shaped pivot as shown in the following sketch:

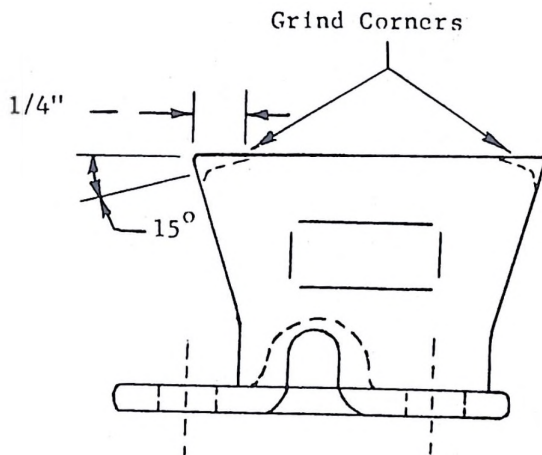

## CLUTCH

GROANING  
NOISE WHILE  
DEPRESSING  
CLUTCH  
PEDAL

ALL  
1963  
PLYMOUTH  
AND  
VALIANT  
MODELS  
EQUIPPED  
WITH  
MANUAL  
TRANSMISSION

POLICY: INFORMATION ONLY.

*J. W. Farley*

J. W. FARLEY  
MANAGER-SERVICE  
CHRYSLER-PLYMOUTH DIVISION

P-4377-C

Service Mgr.	
Shop Foreman	
Technicians	
Parts Mgr.	
Partsmen	