

TECHNICAL SERVICE BULLETIN

Dodge

**DART
CORONET
POLARA
MONACO**



SERVICE DEPARTMENT

November 24, 1965

No. D66-10

REAR AXLE

Rear Axle
Service
Procedure

MODELS: 1966
Coronet V8,
Polara & Monaco

P-4788-C

OF INTEREST TO:

DEALER	
MANAGER	
SERVICE MGR.	
PARTS MGR.	
TECHNICIANS	

This bulletin supplements the information on the rear axle assembly procedure in the Technical Service Manuals.

Before installing the axle shaft tapered bearing cup into the axle housing, the outside diameter of the cup should be lubricated with Automotive Multi-Purpose Grease, NLG1 Grade 2 (Wheel Bearing Lubricant).

NOTE: This operation is necessary as a corrosion preventive.

R. H. KLINE
Manager - Service
DODGE DIVISION

DODGE DIVISION




CHRYSLER
MOTORS CORPORATION

(THIS BULLETIN IS SUPPLIED AS TECHNICAL INFORMATION ONLY AND IS NOT AN AUTHORIZATION FOR REPAIRS) REPRINT OF THIS MATERIAL NOT AUTHORIZED UNLESS APPROVED BY MANAGER OF SERVICE, DODGE DIVISION

TECHNICAL SERVICE BULLETIN

Dodge

**DART
CORONET
POLARA
MONACO**

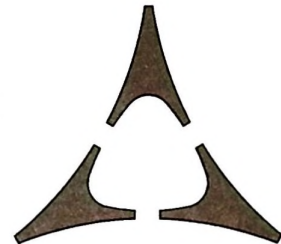

SERVICE DEPARTMENT

November 24, 1965

No. D66-12

REAR AXLE

Rear Axle Shaft
Bearing Removal

MODELS: All
1965 Custom 880
and 1965 & 1966
Coronet, Polara
and Monaco

P-4791-C

OF INTEREST TO:

DEALER	
MANAGER	
SERVICE MGR.	
PARTS MGR.	
TECHNICIANS	

It has been brought to our attention that in some instances returned rear axle shaft bearings show that a cutting torch has been used for removal.

This method of removal is definitely in error, and should not be condoned.

The procedure for removal as outlined in the Technical Service Manual must be followed. Using a torch for removal feeds heat into the axle shaft bearing journal and weakens it in this highly stressed area.

R. H. KLINE
Manager - Service
DODGE DIVISION

DODGE DIVISION



CHRYSLER
MOTORS CORPORATION

(THIS BULLETIN IS SUPPLIED AS TECHNICAL INFORMATION ONLY AND IS NOT AN AUTHORIZATION FOR REPAIRS) REPRINT OF THIS MATERIAL NOT AUTHORIZED UNLESS APPROVED BY MANAGER OF SERVICE, DODGE DIVISION

TECHNICAL SERVICE BULLETIN

Dodge

**DART
CORONET
POLARA
MONACO**



SERVICE DEPARTMENT

May 18, 1966

No. D66-80

REAR AXLE

Sure Grip
Differential
Lubricant

Should you encounter a noise complaint such as chatter or knocking, when cornering, improper lubricant may be the cause. Continued use with incorrect lubricant can also cause scoring of the differential clutch plates and possible subsequent failure of the unit.

It is recommended that before any Sure-Grip Differential is disassembled for any noise condition the lubricant be changed to the specified Sure-Grip Differential Lubricant, Part Number 2585318, and roadtested for several miles to determine if the lubricant corrects this condition. Do not use an "All Purpose" rear axle lubricant under any circumstances.

R. H. KLINE
Manager - Service
DODGE DIVISION

MODELS: All
1966 Models

P-1933-C

OF INTEREST TO:	
DEALER	
MANAGER	
SERVICE MGR.	
PARTS MGR.	
TECHNICIANS	