



# Technical Service Bulletin

**DATE** October 11, 1967  
**NUMBER** 67DT-32 **MODEL** A100, D100,200,300. W100,200,300  
**GROUP** LUBRICATION **SUBJECT** INCORRECT DIPSTICK - LA318 ENGINE  
**SUMMARY** INCORRECT DIPSTICK MAY GIVE FALSE OIL LEVEL INDICATION

In some instances, incorrect dipsticks may have inadvertently been installed in LA318 engines in subject model trucks. The incorrect dipstick will indicate that the oil level is two quarts low when the specified amount of engine oil is in the crankcase.

In handling complaints of excessive oil consumption on subject model trucks with the LA318 engine, first verify the accuracy of the dipstick indication.

Drain the oil from the crankcase and refill with four quarts of oil for the A100 and five quarts of oil for "D" and "W" models. Check oil level after sufficient time has elapsed for oil to drain down. If oil level does not reach full mark, order the correct replacement dipstick and replace the oil dipstick when the new one is received. The correct dipstick for A100 models with the LA318 engine is P/N 2532903 received. The correct dipstick for A100 models with the LA318 engine is P/N 2532903 (Stock Class Code "T") and for "D" and "W" models it is P/N 2406194 (Stock Class Code "S").

**Policy:** Submit W.R.O. in proper form for reimbursement. Flat rate time 0.2 hr. when dipstick must be replaced. Return incorrect dipsticks to:

Chrysler Corp. Warranty Material Center  
11111 French Road  
Detroit, Michigan 48234  
Attn: Dodge Truck Service Dept.

R. H. KLINE  
Manager - Service  
DODGE DIVISION

P-3106

Correspondence pertaining to the content of this bulletin should be directed to: Dodge Truck Service Department, P.O. Box 2088, Detroit, Michigan 48231. (This bulletin is supplied as technical information only and is not an authorization for repairs.) Reprint of this material not authorized unless approved by Manager of Service, Dodge Division.